



TO: ALL REGENCY COMMUNICATIONS PROFESSIONAL SALES AND SERVICE CENTERS
ALL REGENCY COMMUNICATIONS PROFESSIONAL SALES REPRESENTATIVES

MODEL AFFECTED: XLH257

SYMPTOM: RADIO RESETS TO CHANNEL 1 WHEN STARTING ENGINE

CAUSE:

Impulse on 13V power supply line causing reset on Control Board (Q103, 104, 105 reset circuit).

SOLUTION:

Add a 27K ohm resistor (Regency P/N 4704-0273-032) from the base of Q103 to ground.

PRODUCTION CHANGES:

No production changes will be made. Add resistor as required.

SERVICE MANUAL CHANGES:

None

TECHNICAL SERVICE DEPARTMENT
REGENCY COMMUNICATIONS, INC.

